

Centurion® Pool and Spa Pump Motors Square Flange

**Permanent Split Capacitor • Switchless • Single Phase • Drip-proof
• Round Frame • 3600 and 3600/1800 RPM • 1/2 thru 3 HP**

Features: Ball bearing • 60 Hz • 50°C Ambient • Class B Insulated • CW Non-Reversible • Stainless Steel Shafts
• Energy Efficient

Applications: Replacement motor for Sta-Rite, HydroTech, Premier, AquaFlo, Red Jacket, Sears and PAC/FAB brand pumps. Can be used on Sta-Rite, Red Jacket and Sears home water systems.




B852

HP	RPM	Volts	Service Factor Amps	Service Factor	Frame	Stock Number	Shaft	Overload Protector	"C" Dim.	Notes
Centurion® "1081" • Full Rate • High Service Factor										
1/2	3600	230/115	5.4/10.8	1.95	56Y	B846	Threaded	Auto	12.34	
3/4	3600	230/115	7.1/14.2	1.65	56Y	B847	Threaded	Auto	12.34	
1	3600	230/115	8.0/16.0	1.65	56Y	B848	Threaded	Auto	12.72	
1-1/2	3600	230/115	11.2/22.4	1.50	56Y	B858	Threaded	Auto	14.34	
		230	10.0	1.50	56Y	B849	Threaded	Auto	13.34	
2	3600	230	11.5	1.30	56Y	B748	Threaded	Auto	13.34	
Centurion® "1081" • Up-Rate • Low Service Factor										
1/2	3600	230/115	4.0/8.0	1.30	56Y	B856	Threaded	Auto	12.34	
3/4	3600	230/115	5.4/10.8	1.25	56Y	B852	Threaded	Auto	12.34	
1	3600	230/115	7.1/14.2	1.25	56Y	B853	Threaded	Auto	12.34	
1-1/2	3600	230/115	8.0/16.0	1.10	56Y	B854	Threaded	Auto	12.72	
2	3600	230/115	11.2/22.4	1.10	56Y	B859	Threaded	Auto	14.34	
		230	10.0	1.10	56Y	B855	Threaded	Auto	13.34	
2-1/2	3600	230	11.5	1.04	56Y	B840	Threaded	Auto	13.84	
Centurion® "1081" • Up-Rate • Low Service Factor										
1/2	3600	230/115	3.6/7.2	1.30	48Y	B850SM	Threaded	Auto	12.33	1,2,3
3/4	3600	230/115	5.4/10.8	1.25	48Y	B852SM	Threaded	Auto	12.33	1,2,3
1	3600	230/115	5.9/11.8	1.25	48Y	B853SM	Threaded	Auto	12.63	1,2,3
E-Plus® Energy Efficient "1081" • Centurion • Full Rate • Suitable for 50 Hz, 1.0 Service Factor										
1/2	3600	208-230/115	4.4-4.5/8.8	1.90	56Y	B845	Threaded	Auto	12.34	\$
3/4	3600	208-230/115	6.0-5.6/11.2	1.67	56Y	B861	Threaded	Auto	13.09	\$
1	3600	208-230/115	7.8-7.4/14.8	1.65	56Y	B841	Threaded	Auto	13.34	\$
1-1/2	3600	208-230	9.6-8.8	1.47	56Y	B842	Threaded	Auto	13.84	\$
2	3600	208-230	11.0-10.0	1.30	56Y	B843	Threaded	Auto	14.34	\$
3	3600	208-230	15.0-13.8	1.15	56Y	B844	Threaded	Auto	14.34	\$
E-Plus® Energy Efficient "1081" • Centurion SE • Up-Rate										
3/4	3600	208-230/115	4.5-4.4/8.8	1.25	56Y	B862SE	Threaded	Auto	13.54	3 \$
1	3600	208-230/115	6.0-5.6/11.2	1.25	56Y	B863SE	Threaded	Auto	13.54	3 \$
1-1/2	3600	208-230/115	7.8-7.4/14.8	1.10	56Y	B864SE	Threaded	Auto	14.04	3 \$
2	3600	208-230	9.6-8.8	1.10	56Y	B865SE	Threaded	Auto	14.92	3 \$
2-1/2	3600	208-230	11.0-10.0	1.04	56Y	B866SE	Threaded	Auto	14.92	3 \$
Two Speed "1081" • Full Rate • High Service Factor • 40°C Ambient										
Speed Switchless, Low Speed Microswitch • Square Flange • Hi-Lo Toggle Switch Assembly Available (Part # 17590450)										
75/12	3600/1800	230	5.0/2.3	1.67	56Y	B860	Threaded	Auto	13.09	
75/12	3600/1800	115	14.6/4.7	1.67	56Y	B861	Threaded	Auto	12.59	
17/15	3600/1800	230	7.2/3.0	1.65	56Y	B862	Threaded	Auto	13.34	
15/25	3600/1800	230	10.0/3.5	1.47	56Y	B863	Threaded	Auto	13.84	
27/33	3600/1800	230	11.0/4.0	1.30	56Y	B864	Threaded	Auto	14.34	
		230	10.0/3.5	1.10	56Y	B865	Threaded	Auto	13.84	

Notes:

- Item to be discontinued when present stock is depleted
- Centurion® motors are switchless. Designed in a 48-frame shell diameter that is .80 inches smaller in diameter than the 56-frame Centurion and Centurion SE designs.
- Open motor construction, overload protector mounted at 12 o'clock

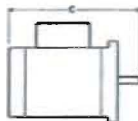

A.O. SMITH
ELECTRIC PRODUCTS
COMPANY

www.aosmithmotors.com

INCL # 4
PAGE # 1

DOCKET
08-AAEP-1B
DATE _____
RECD. SEP 03 2008

Square Flange Pool Motors • Two Speed

Important: Total output (HP x Service Factor) of replacement motor must equal or exceed motor being replaced.

Used on many Sta-Rite, Red Jacket, and Sears Jet and Pool Pumps

Features: All Copper Windings • Auto Protector -1Ø • Capacitor Start
• Open Drip Proof • Rotation (CCW Pump End) • Threaded Shaft
• 303 Stainless Steel • 50° C Ambient • 60 HZ



SQS1072R



SQS1152R

HIGH SERVICE FACTOR

HP	RPM	Volts	Amps Hi - Lo	S.F.	Frame	Stock Number	Approx. "AG"	Conn. Dia.	Notes	
3/4-1/8	3450/1725	115	12/4	1.65	48Y	SQS1072R	12-5/8	41	1,2	\$
		230	7.3/2.6	1.65	48Y	SQS1072R	13-1/8	41	2	
1-1/8	3450/1725	230	9.5/2.5	1.65	48Y	SQS1102R	13-13/16	41	2	
1-1/2-1/4	3450/1725	230	10.4/3.7	1.47	48Y	SQS1152R	13-13/16	41	1,2	\$
2-1/3	3450/1725	230	11.4/4.1	1.3	56Y	SQS1202R	14-27/32	41	1,2	\$

LOW SERVICE FACTOR (UP-RATED)

HP	RPM	Volts	Amps Hi - Lo	S.F.	Frame	Stock Number	Approx. "AG"	Conn. Dia.	Notes	
1-1/8	3450/1725	230	7.3/2.6	1.25	48Y	UQS1102R	13-1/8	41	2	
1-1/2-1/4	3450/1725	230	9.5/2.5	1.1	48Y	UQS1152R	13-13/16	41	2	
2-1/3	3450/1725	230	10.4/3.7	1.1	48Y	UQS1202R	13-13/16	41	1,2	\$

Notes:

1. \$ Energy Efficient capacitor start, capacitor run "Conservationist" motor
2. 2 speed shipped less hi/lo switch for remote operation

Three Phase Square Flange Pump Motors

Features: All Copper Windings • Open Drip Proof • Stainless Steel - (303) Threaded Shaft
• Sealed Ball Bearings • 50° C Ambient • 60 HZ




Q3052

HP	RPM	Volts	Max. Amps	Service Factor	Frame	Stock Number	Overload Protector	Approx. "AG"	Conn. Dia.
1/2	3450	208-230/460	3.0/1.5	1.9	48Y	Q3052	None	9-7/8	29
3/4	3450	208-230/460	3.6/1.8	1.65	48Y	Q3072	None	12-5/8	29
1	3450	208-230/460	4.7/2.35	1.65	48Y	Q3102	None	10-7/8	29
1-1/2	3450	208-230/460	6.8/3.4	1.47	48Y	Q3152	None	11-7/8	29
2	3450	208-230/460	8.5/4.25	1.3	48Y	Q3202	None	12-5/8	29
3	3450	208-230/460	9.7/4.9	1.15	56Y	Q3302	None	12-7/32	29

Note:

See page 117 for mounting dimensions.

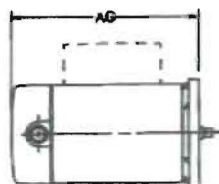

E-Plus
Low SP

Centurion® Pool and Spa Pump Motors Square Flange

Permanent Split Capacitor • Switchless • Single Phase • Dripproof • Round Frame • 3600 and 3600/1800 RPM • 1/2 thru 3 HP

Features: Ball bearing • 60 Hz • 50°C Ambient • Class B Insulated • CW Non-Reversible • Stainless Steel Shafts • Energy Efficient

Applications: Replacement motor for Sta-Rite, HydroTech, Premier, AquaFlo, Red Jacket, Sears and PAC/FAB brand pumps. Can be used on Sta-Rite, Red Jacket and Sears home water systems.




B852

HP	RPM	Volts	Service Factor Amps	Service Factor	Frame	Stock Number	Shaft	Overload Protector	"C" Dim.	Notes
Centurion® "1081" • Full Rate • High Service Factor										
1/2	3600	230/115	5.4/10.8	1.95	56Y	B846	Threaded	Auto	12.34	
3/4	3600	230/115	7.1/14.2	1.65	56Y	B847	Threaded	Auto	12.34	
1	3600	230/115	8.0/16.0	1.65	56Y	B848	Threaded	Auto	12.72	
1-1/2	3600	230/115	11.2/22.4	1.50	56Y	B858	Threaded	Auto	14.34	
		230	10.0	1.50	56Y	B849	Threaded	Auto	13.34	
2	3600	230	11.5	1.30	56Y	B748	Threaded	Auto	13.34	
Centurion® "1081" • Up-Rate • Low Service Factor										
1/2	3600	230/115	4.0/8.0	1.30	56Y	B856	Threaded	Auto	12.34	
3/4	3600	230/115	5.4/10.8	1.25	56Y	B852	Threaded	Auto	12.34	
1	3600	230/115	7.1/14.2	1.25	56Y	B853	Threaded	Auto	12.34	
1-1/2	3600	230/115	8.0/16.0	1.10	56Y	B854	Threaded	Auto	12.72	
2	3600	230/115	11.2/22.4	1.10	56Y	B859	Threaded	Auto	14.34	
		230	10.0	1.10	56Y	B855	Threaded	Auto	13.34	
3-1/2	3600	230	11.5	1.04	56Y	B840	Threaded	Auto	13.84	
Centurion® II "1081" • Up-Rate • Low Service Factor										
1/2	3600	230/115	3.6/7.2	1.30	48Y	B865SM	Threaded	Auto	12.33	1,2,3
3/4	3600	230/115	5.4/10.8	1.25	48Y	B866SM	Threaded	Auto	12.33	1,2,3
1	3600	230/115	5.9/11.8	1.25	48Y	B867SM	Threaded	Auto	12.83	1,2,3
E-Plus® Energy Efficient "1081" • Centurion • Full Rate • Suitable for 50 Hz, 1.0 Service Factor										
1/2	3600	208-230/115	4.4-4.5/8.8	1.90	56Y	B845	Threaded	Auto	12.34	\$
3/4	3600	208-230/115	6.0-6.8/11.2	1.67	56Y	B861	Threaded	Auto	13.09	\$
1	3600	208-230/115	7.8-7.4/14.8	1.65	56Y	B841	Threaded	Auto	13.34	\$
1-1/2	3600	208-230	9.6-8.8	1.47	56Y	B842	Threaded	Auto	13.84	\$
2	3600	208-230	11.0-10.0	1.30	56Y	B843	Threaded	Auto	14.34	\$
3	3600	208-230	15.0-13.6	1.15	56Y	B844	Threaded	Auto	14.34	\$
E-Plus® Energy Efficient "1081" • Centurion SE • Up-Rate										
3/4	3600	208-230/115	4.5-4.4/8.8	1.25	56Y	B862SE	Threaded	Auto	13.54	3 \$
1	3600	208-230/115	6.0-5.6/11.2	1.25	56Y	B863SE	Threaded	Auto	13.54	3 \$
1-1/2	3600	208-230/115	7.8-7.4/14.8	1.10	56Y	B864SE	Threaded	Auto	14.04	3 \$
2	3600	208-230	9.6-8.8	1.10	56Y	B865SE	Threaded	Auto	14.92	3 \$
2-1/2	3600	208-230	11.0-10.0	1.04	56Y	B866SE	Threaded	Auto	14.92	3 \$
Two Speed "1081" • Full Rate • High Service Factor • 40°C Ambient										
High Speed Switchless, Low Speed Microswitch • Square Flange • Hi-Lo Toggle Switch Assembly Available (Part # 17590450)										
75/12	3600/1800	230	6.0/2.3	1.67	56Y	B880	Threaded	Auto	13.09	
75/12	3600/1800	115	14.6/4.7	1.67	56Y	B881	Threaded	Auto	12.59	
15/16	3600/1800	230	7.2/3.0	1.65	56Y	B882	Threaded	Auto	13.34	
15/25	3600/1800	230	10.0/3.5	1.47	56Y	B883	Threaded	Auto	13.84	
21/33	3600/1800	230	11.0/4.0	1.30	56Y	B884	Threaded	Auto	14.34	
		230	10.0/3.5	1.10	56Y	B885	Threaded	Auto	13.84	

Notes:

- Item to be discontinued when present stock is depleted
- Centurion® motors are switchless. Designed in a 48-frame shell diameter that is .80 inches smaller in diameter than the 56-frame Centurion and Centurion SE designs.
- Open motor construction, overload protector mounted at 12 o'clock

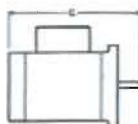

A.O. SMITH
MOTOR PRODUCTS
COMPANY

www.aosmithmotors.com

Centurion® Pool and Spa Pump Motors Square Flange

E-Plus
HIGH SF

**Permanent Split Capacitor • Switchless • Single Phase • Drip-proof
• Round Frame • 3600 and 3600/1800 RPM • 1/2 thru 3 HP**

Features: Ball bearing • 60 Hz • 50°C Ambient • Class B Insulated • CW Non-Reversible • Stainless Steel Shafts
• S Energy Efficient

Applications: Replacement motor for Sta-Rite, HydroTech, Premier, AquaFlo, Red Jacket, Sears and PAC/FAB brand pumps. Can be used on Sta-Rite, Red Jacket and Sears home water systems.




B852

HP	RPM	Volts	Service Factor Amps	Service Factor	Frame	Stock Number	Shaft	Overload Protector	"C" Dim.	Notes
Centurion® "1081" • Full Rate • High Service Factor										
1/2	3600	230/115	5.4/10.8	1.95	56Y	B846	Threaded	Auto	12.34	
3/4	3600	230/115	7.1/14.2	1.65	56Y	B847	Threaded	Auto	12.34	
1	3600	230/115	8.0/16.0	1.65	56Y	B848	Threaded	Auto	12.72	
1-1/2	3600	230/115	11.2/22.4	1.50	56Y	B858	Threaded	Auto	14.34	
		230	10.0	1.50	56Y	B849	Threaded	Auto	13.34	
2	3600	230	11.5	1.30	56Y	B748	Threaded	Auto	13.34	
Centurion® "1081" • Up-Rate • Low Service Factor										
1/2	3600	230/115	4.0/8.0	1.30	56Y	B856	Threaded	Auto	12.34	
3/4	3600	230/115	5.4/10.8	1.25	56Y	B852	Threaded	Auto	12.34	
1	3600	230/115	7.1/14.2	1.25	56Y	B853	Threaded	Auto	12.34	
1-1/2	3600	230/115	8.0/16.0	1.10	56Y	B854	Threaded	Auto	12.72	
2	3600	230/115	11.2/22.4	1.10	56Y	B859	Threaded	Auto	14.34	
		230	10.0	1.10	56Y	B855	Threaded	Auto	13.34	
2-1/2	3600	230	11.5	1.04	56Y	B840	Threaded	Auto	13.84	
Centurion® II "1081" • Up-Rate • Low Service Factor										
1/2	3600	230/115	3.6/7.2	1.30	48Y	B856SM	Threaded	Auto	12.33	1,2,3
3/4	3600	230/115	5.4/10.8	1.25	48Y	B852SM	Threaded	Auto	12.33	1,2,3
1	3600	230/115	5.9/11.8	1.25	48Y	B853SM	Threaded	Auto	12.83	1,2,3
E-Plus® Energy Efficient "1081" • Centurion • Full Rate • Suitable for 50 Hz, 1.0 Service Factor										
1/2	3600	208-230/115	4.4-4.5/8.8	1.90	56Y	B845	Threaded	Auto	12.34	\$
3/4	3600	208-230/115	6.0-6.5/11.2	1.67	56Y	B841	Threaded	Auto	13.09	\$
1	3600	208-230/115	7.8-7.4/14.8	1.65	56Y	B841	Threaded	Auto	13.34	\$
1-1/2	3600	208-230	9.6-8.8	1.47	56Y	B842	Threaded	Auto	13.84	\$
2	3600	208-230	11.0-10.0	1.30	56Y	B843	Threaded	Auto	14.34	\$
3	3600	208-230	15.0-13.8	1.15	56Y	B844	Threaded	Auto	14.34	\$
E-Plus® Energy Efficient "1081" • Centurion SE • Up-Rate										
3/4	3600	208-230/115	4.5-4.4/8.8	1.25	56Y	B852SE	Threaded	Auto	13.54	3 \$
1	3600	208-230/115	6.0-5.6/11.2	1.25	56Y	B853SE	Threaded	Auto	13.64	3 \$
1-1/2	3600	208-230/115	7.8-7.4/14.8	1.10	56Y	B854SE	Threaded	Auto	14.04	3 \$
2	3600	208-230	9.6-8.8	1.10	56Y	B855SE	Threaded	Auto	14.92	3 \$
2-1/2	3600	208-230	11.0-10.0	1.04	56Y	B856SE	Threaded	Auto	14.92	3 \$
Two Speed "1081" • Full Rate • High Service Factor • 40°C Ambient										
High Speed Switchless, Low Speed Microswitch • Square Flange • Hi-Lo Toggle Switch Assembly Available (Part # 17590450)										
75/12	3600/1800	230	6.0/2.3	1.67	56Y	B860	Threaded	Auto	13.09	
75/12	3600/1800	115	14.6/4.7	1.67	56Y	B861	Threaded	Auto	12.59	
15/16	3600/1800	230	7.2/3.0	1.65	56Y	B862	Threaded	Auto	13.34	
15/25	3600/1800	230	10.0/3.5	1.47	56Y	B863	Threaded	Auto	13.84	
25/33	3600/1800	230	11.0/4.0	1.30	56Y	B864	Threaded	Auto	14.34	
		230	10.0/3.5	1.10	56Y	B865	Threaded	Auto	13.84	

Notes:

- Item to be discontinued when present stock is depleted
- Centurion® motors are switchless. Designed in a 48-frame shell diameter that is .80 inches smaller in diameter than the 56-frame Centurion and Centurion SE designs.
- Open motor construction, overload protector mounted at 12 o'clock

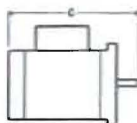

A.O. SMITH
CENTURION MOTORS
CORPORATION

www.aosmithmotors.com

Centurion® Pool and Spa Pump Motors Square Flange

**Permanent Split Capacitor • Switchless • Single Phase • Dripproof
• Round Frame • 3600 and 3600/1800 RPM • ½ thru 3 HP**

Features: Ball bearing • 60 Hz • 50°C Ambient • Class B Insulated • CW Non-Reversible • Stainless Steel Shafts
• \$ Energy Efficient

Applications: Replacement motor for Sta-Rite, HydroTech, Premier, AquaFlo, Red Jacket, Sears and PAC/FAB brand pumps. Can be used on Sta-Rite, Red Jacket and Sears home water systems.




B862

HP	RPM	Volts	Service Factor Amps	Service Factor	Frame	Stock Number	Shaft	Overload Protector	"C" Dim.	Notes
Centurion® "1081" • Full Rate • High Service Factor										
1/2	3600	230/115	5.4/10.8	1.95	56Y	B846	Threaded	Auto	12.34	
3/4	3600	230/115	7.1/14.2	1.65	56Y	B847	Threaded	Auto	12.34	
1	3600	230/115	8.0/16.0	1.65	56Y	B848	Threaded	Auto	12.72	
1-1/2	3600	230/115	11.2/22.4	1.50	56Y	B858	Threaded	Auto	14.34	
		230	10.0	1.50	56Y	B849	Threaded	Auto	13.34	
2	3600	230	11.5	1.30	56Y	B748	Threaded	Auto	13.34	
Centurion® "1081" • Up-Rate • Low Service Factor										
1/2	3600	230/115	4.0/8.0	1.30	56Y	B856	Threaded	Auto	12.34	
3/4	3600	230/115	5.4/10.8	1.25	56Y	B862	Threaded	Auto	12.34	
1	3600	230/115	7.1/14.2	1.25	56Y	B863	Threaded	Auto	12.34	
1-1/2	3600	230/115	8.0/16.0	1.10	56Y	B864	Threaded	Auto	12.72	
2	3600	230/115	11.2/22.4	1.10	56Y	B869	Threaded	Auto	14.34	
		230	10.0	1.10	56Y	B865	Threaded	Auto	13.34	
2-1/2	3600	230	11.5	1.04	56Y	B840	Threaded	Auto	13.84	
Centurion® II "1081" • Up-Rate • Low Service Factor										
1/2	3600	230/115	3.6/7.2	1.30	48Y	B858SM	Threaded	Auto	12.33	1,2,3
3/4	3600	230/115	5.4/10.8	1.25	48Y	B862SM	Threaded	Auto	12.33	1,2,3
1	3600	230/115	5.9/11.8	1.25	48Y	B863SM	Threaded	Auto	12.83	1,2,3
E-Plus® Energy Efficient "1081" • Centurion • Full Rate • Suitable for 50 Hz, 1.0 Service Factor										
1/2	3600	208-230/115	4.4-4.5/8.8	1.90	56Y	B845	Threaded	Auto	12.34	\$
3/4	3600	208-230/115	6.0-6.6/11.2	1.67	56Y	B861	Threaded	Auto	13.09	\$
1	3600	208-230/115	7.8-7.4/14.8	1.65	56Y	B841	Threaded	Auto	13.34	\$
1-1/2	3600	208-230	9.6-8.8	1.47	56Y	B842	Threaded	Auto	13.84	\$
2	3600	208-230	11.0-10.0	1.30	56Y	B843	Threaded	Auto	14.34	\$
3	3600	208-230	15.0-13.6	1.15	56Y	B844	Threaded	Auto	14.34	\$
E-Plus® Energy Efficient "1081" • Centurion SE • Up-Rate										
3/4	3600	208-230/115	4.5-4.4/8.8	1.25	56Y	B862SE	Threaded	Auto	13.54	3 \$
1	3600	208-230/115	6.0-5.6/11.2	1.25	56Y	B863SE	Threaded	Auto	13.54	3 \$
1-1/2	3600	208-230/115	7.8-7.4/14.8	1.10	56Y	B864SE	Threaded	Auto	14.04	3 \$
2	3600	208-230	9.6-8.8	1.10	56Y	B865SE	Threaded	Auto	14.92	\$
2-1/2	3600	208-230	11.0-10.0	1.04	56Y	B866SE	Threaded	Auto	14.92	3 \$
Two Speed "1081" • Full Rate • High Service Factor • 40°C Ambient										
High Speed Switchless, Low Speed Microswitch • Square Flange • Hi-Lo Toggle Switch Assembly Available (Part # 17590450)										
7.5/12	3600/1800	230	6.0/2.3	1.67	56Y	B980	Threaded	Auto	13.09	
7.5/12	3600/1800	115	14.8/4.7	1.67	56Y	B981	Threaded	Auto	12.59	
1.5/15	3600/1800	230	7.2/3.0	1.65	56Y	B982	Threaded	Auto	13.34	
1.5/25	3600/1800	230	10.0/3.5	1.47	56Y	B983	Threaded	Auto	13.84	
2/33	3600/1800	230	11.0/4.0	1.30	56Y	B984	Threaded	Auto	14.34	
		230	10.0/3.5	1.10	56Y	B985	Threaded	Auto	13.84	

Notes:

- Item to be discontinued when present stock is depleted
- Centurion® motors are switchless. Designed in a 48-frame shell diameter that is .80 inches smaller in diameter than the 56-frame Centurion and Centurion SE designs.
- Open motor construction, overload protector mounted at 12 o'clock

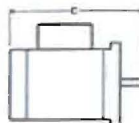

A.O. SMITH
MOTOR PRODUCTS
COMPANY

www.aosmithmotors.com

Centurion® Pool and Spa Pump Motors Square Flange

**Permanent Split Capacitor • Switchless • Single Phase • Dripproof
• Round Frame • 3600 and 3600/1800 RPM • 1/2 thru 3 HP**

Features: Ball bearing • 60 Hz • 50°C Ambient • Class B Insulated • CW Non-Reversible • Stainless Steel Shafts
• Energy Efficient

Applications: Replacement motor for Sta-Rite, HydroTech, Premier, AquaFlo, Red Jacket, Sears and PAC/FAB brand pumps. Can be used on Sta-Rite, Red Jacket and Sears home water systems.




B862

HP	RPM	Volts	Service Factor Amps	Service Factor	Frame	Stock Number	Shaft	Overload Protector	"C" Dim.	Notes
Centurion® "1081" • Full Rate • High Service Factor										
1/2	3600	230/115	5.4/10.8	1.95	56Y	B846	Threaded	Auto	12.34	
3/4	3600	230/115	7.1/14.2	1.65	56Y	B847	Threaded	Auto	12.34	
1	3600	230/115	8.0/16.0	1.65	56Y	B848	Threaded	Auto	12.72	
1-1/2	3600	230/115	11.2/22.4	1.50	56Y	B858	Threaded	Auto	14.34	
		230	10.0	1.50	56Y	B849	Threaded	Auto	13.34	
2	3600	230	11.5	1.30	56Y	B748	Threaded	Auto	13.34	
Centurion® "1081" • Up-Rate • Low Service Factor										
1/2	3600	230/115	4.0/8.0	1.30	56Y	B856	Threaded	Auto	12.34	
3/4	3600	230/115	5.4/10.8	1.25	56Y	B852	Threaded	Auto	12.34	
1	3600	230/115	7.1/14.2	1.25	56Y	B853	Threaded	Auto	12.34	
1-1/2	3600	230/115	8.0/16.0	1.10	56Y	B854	Threaded	Auto	12.72	
2	3600	230/115	11.2/22.4	1.10	56Y	B859	Threaded	Auto	14.34	
		230	10.0	1.10	56Y	B856	Threaded	Auto	13.34	
2-1/2	3600	230	11.5	1.04	56Y	B840	Threaded	Auto	13.84	
Centurion® II "1081" • Up-Rate • Low Service Factor										
1/2	3600	230/115	3.6/7.2	1.30	48Y	B866SM	Threaded	Auto	12.33	1,2,3
3/4	3600	230/115	5.4/10.8	1.25	48Y	B862SM	Threaded	Auto	12.33	1,2,3
1	3600	230/115	5.9/11.8	1.25	48Y	B863SM	Threaded	Auto	12.83	1,2,3
E-Plus® Energy Efficient "1081" • Centurion • Full Rate • Suitable for 50 Hz, 1.0 Service Factor										
1/2	3600	208-230/115	4.4-4.5/8.8	1.90	56Y	B846	Threaded	Auto	12.34	\$
3/4	3600	208-230/115	6.0-5.6/11.2	1.67	56Y	B841	Threaded	Auto	13.09	\$
1	3600	208-230/115	7.8-7.4/14.8	1.65	56Y	B841	Threaded	Auto	13.34	\$
1-1/2	3600	208-230	9.6-8.8	1.47	56Y	B842	Threaded	Auto	13.84	\$
2	3600	208-230	11.0-10.0	1.39	56Y	B843	Threaded	Auto	14.34	\$
3	3600	208-230	15.0-13.6	1.15	56Y	B844	Threaded	Auto	14.34	\$
E-Plus® Energy Efficient "1081" • Centurion SE • Up-Rate										
3/4	3600	208-230/115	4.5-4.4/8.8	1.25	56Y	B862SE	Threaded	Auto	13.54	\$ 3
1	3600	208-230/115	6.0-5.6/11.2	1.25	56Y	B863SE	Threaded	Auto	13.54	\$ 3
1-1/2	3600	208-230/115	7.8-7.4/14.8	1.10	56Y	B864SE	Threaded	Auto	14.04	\$ 3
2	3600	208-230	9.6-8.8	1.10	56Y	B865SE	Threaded	Auto	14.92	\$
2-1/2	3600	208-230	11.0-10.0	1.04	56Y	B866SE	Threaded	Auto	14.92	\$ 3
Two Speed "1081" • Full Rate • High Service Factor • 40°C Ambient										
High Speed Switchless, Low Speed Microswitch • Square Flange • Hi-Lo Toggle Switch Assembly Available (Part # 17590450)										
7.5/12	3600/1800	230	6.0/2.3	1.67	56Y	B880	Threaded	Auto	13.09	
7.5/12	3600/1800	115	14.6/4.7	1.67	56Y	B881	Threaded	Auto	12.59	
1/16	3600/1800	230	7.2/3.0	1.65	56Y	B882	Threaded	Auto	13.34	
1.5/2.5	3600/1800	230	10.0/3.5	1.47	56Y	B883	Threaded	Auto	13.84	
2/3.3	3600/1800	230	11.0/4.0	1.30	56Y	B884	Threaded	Auto	14.34	
		230	10.0/3.5	1.10	56Y	B885	Threaded	Auto	13.84	

Notes:

- Item to be discontinued when present stock is depleted
- Centurion® motors are switchless. Designed in a 48-frame shell diameter that is .80 inches smaller in diameter than the 56-frame Centurion and Centurion SE designs.
- Open motor construction, overload protector mounted at 12 o'clock.

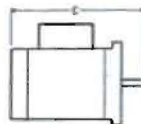

A.O. SMITH
MOTOR PRODUCTS
COMPANY

www.aosmithmotors.com